

## **US 2200 XC2 - DATA SHEET**



**Application:** Wherever Deep Cycle 6-volt batteries are needed.

**Dimensions:** 10-1/4 (260)L x 7-1/8 (181)W x 11-1/4 (286)H

**Type:** Flooded Lead Acid (FLA) non-sealed.

Case material: Polypropylene / Heat Sealed



											5			- 110	AT					
																		•		
BCI												Standard	AMP	MINUTES	MINUTES	MINUTES				wet
Group	Model	4 hu	2 hu	5-hr	G hu	10 hr	20 64	40 hu	72 hr	100 be	Voltono	T	HOURS				Lanath	MENT	Hoight	147-1-64
Group	Wouei	1-III	2-111	D-III	0-111	IU-III	20-III	40-111	/ Z-III	100-111	Vullage	Terminal	HUUKS	@	@	@	Lengin	wiatn	Height	Weight
Size		Rate	Rate	Rate	Rate	Rate	Rate	Rate	Rate	Rate		Type	(20 UD DATE)	75 AMPS	56 AMPS	25 AMPS				Lhe (ka)
0.20		Huto	mato	Huto	IIIII	Huto	Huto	Hato	liuto	Huto		турс	(20 fin. haie)	70 AMI O	56 AMPS	20 AMI O	10-1/4	7-1/8	11-1/4	LUS (NY)
																			(000)	
GC2	US 2200 XC2	133	152	181	187	206	232	246	252	258	6	UTL	232	122	175	474	(260)	(181)	(286)	62 (28)

### **TERMINAL OPTIONS:**









DUAL







## **CHARGING INSTRUCTIONS:**

Following is the charging recommendation and charging profile using 2 stage chargers for US Battery deep cycle products. \*Equalization and float charge modes are not considered to be one of the stages in a charging profile.

1. Bulk Charge Constant current @~10% of C/20 Ah in amps to 2.45+/-0.05 volts per cell

(e.g. 7.35 volts +/-0.15 volts per 6 volt battery)

2. **Absorption Charge** Constant voltage (2.45+/-0.05 vpc) to 3% of C/20 Ah in amps then hold for 2-3 hours and terminate charge

Charge termination can be by maximum time (2-4 hr) or dV/dt (4 mv/cell per hour)

• (Optional Float Charge) Constant voltage 2.17 vpc (6.51 volts per 6 volt battery) for unlimited time

**Equalization Charge** Constant voltage (2.55+/-0.05 vpc) extended for 1-3 hours after normal charge cycle (repeat every 30 days)

**Notes:** Charge time from full discharge is 9-12 hours.

Absorption charge time is determined by the battery but will usually be ~3 hours at 2.45 volts per cell.

Float time is unlimited at 2.17 volts per cell. Specific gravity at full charge is 1.270 minimum

**Battery temperature adjustment:** reduce the voltage by 0.028 Volts per cell for every 10°F above 80°F, increase by the same amount for temperatures below 80°F.


Deep cycle batteries need to be equalized periodically. Equalizing is an extended, low current charge performed after the normal charge cycle. This extra charge helps keep all cells in balance. Actively used batteries should be equalized once per month.


Manually timed chargers should have the charge time extended approximately 3 hours.


Automatically controlled chargers should be unplugged and reconnected after completing a charge.


## US 2200 XC2 - DATA SHEET

Deep Cycle 6 -Volt

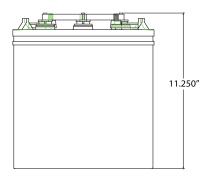


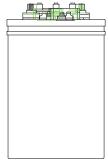

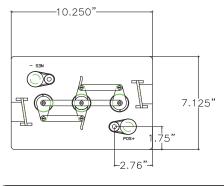

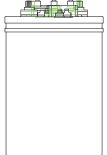

100,00	0 <u>#</u>	-																			
	1											<b>⊕</b> Fl	oode	ed Bat	tery	Сус	le Lif	e (X0	C & X	(C2)	
		★AGM Battery Cycle Life (>200.										Ah)									
10,00	ا ا		7000	331	10							<b>▲</b> A	GM E	Batter	у Су	cle L	.ife (	<200	Ah)		
			3860			205	0														
	$\perp$		2550					14	75	11	50	950		780		675					
1,00	"≣					1150				11	00			-				59			
	=									500						70	10				50
										000				4		$\neg$					- 2
	$\vdash$																	_		250	_
10																					
10	0	1	0	2	20	3	0	4	10	5	0	6	0	70		8	0	9	0	10	00

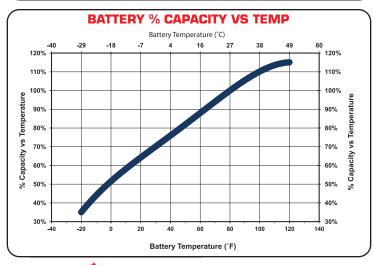



1675 Sampson Avenue Corona, CA 92879

(800) 695-0945

U.S. Battery Recommended Terminal Torque and Connection Hardware U.S. Battery Terminal Type Recommended Torque (ft-lb) Recommended Connection Hardware Recommended Torque (in-lb) UTL 95-105 7.9-8.8 <sup>1</sup>SS Hexnut with Lock Washer 95-105 1SS Hexnut with Lock Washer UT 7.9-8.8 Flat Block 95-105 7.9-8.8 <sup>1</sup>SS Hexnut with Lock Washer Dual 95-105 7.9-8.8 1/6SS Hexnut with Lock Washer DC Marine 95-105 7.9-8.8 2SS Hexnut with Lock Washer Off-Set "S" 100-120 8.3-10 3Zn or SS Bolt w/Hexnut & Lock Washer Flag 8.3-10 47n or SS Bolt w/Hexnut & Lock Washer 100-120 Large "L 100-120 8.3-10.0 <sup>4</sup>Zn or SS Bolt w/Hexnut & Lock Washer Small "L' 100-120 8.3-10.0 <sup>4</sup>Zn or SS Bolt w/Hexnut & Lock Washer Bus Lug 120-180 10.0-15.0 5SS Hexnut with Lock Washer SAE 50-70 4.2-5.8 <sup>6</sup>No Hardware Supplied

Proper connection is to position a lock washer between the nut and the connector (never between the connector and lead terminal) and apply the recommended torque or enough torque to completely compress the lock washer without deforming the lead terminal.

<sup>1</sup>Stainless Steel Hexnut with Stainless Steel Split-Ring Lock Washer (5/16" Positive & Negative) <sup>2</sup>Stainless Steel Hexnut with Stainless Steel Split-Ring Lock Washer (3/8" Positive & 5/16" Negative) Square-Head. SS or Zinc-Plated Bolt with SS or Zinc-Plated Hexnut & Split-Ring Lock Washer 4Square-Head or Hex-Head, SS or Zinc-Plated Bolt with SS or Zinc-Plated Hexnut & Split-Ring Lock Washer <sup>5</sup>Stainless Steel Hexnut with SS Split-Ring Lock Washer (1/2" Positive or 3/8" Positive & 3/8" Negative) <sup>6</sup>No Hardware Supplied - Application Uses SAE Clamp for Positive & Negative Tapered Post

Note: The use of flanged nuts and other types of nuts with captive washers or other hardware not listed above is not recommended by US Battery and their use may void the battery warranty.

# US 2200 XC2 DISCHARGE TIME VS CURRENT @80° F Discharge Time vs Current @80°F Discharge Time (hours) 0.1 100 Discharge Current (amps)

#### **U.S. Battery Operating Temperature Guidelines**

For charging, we recommend staying within O°F to 120°F (-18 to 49°C) to avoid charging frozen batteries at low temperature or going into thermal runaway at high temperature.

For discharging, we recommend -20°F to 120°F (-29 to 49°C). Batteries discharged at temperatures below 32°F (0°C) should be recharged immediately to avoid freezing.

Batteries discharged at temperatures above 120°F (49°C) should be allowed to cool before recharging.

Extreme temperatures can substantially affect battery performance and charging. Cold reduces battery capacity and retards charging. Heat increases water usage and can result in overcharging. Very high temperatures can cause "thermal run-away" which may lead to an explosion or fire. If extreme temperature is an unavoidable part of an application, consult a battery/charger specialist about ways to deal with the problem.

Data references within this publication are nominal and should not be considered or construed as maximum or minimum values for specifications or for final design. Data for this product type and model may vary from what is shown in this publication, and U.S. Battery Mfg., Co. makes No warranties, expressed or implied based on the data within this publication.

©2013 U.S. Battery Mfg., Co. All rights reserved. U.S Battery is not liable for damages that may occur from any information provided in or omitted from this publication, under any circumstances. U.S. Battery Mfg., Co. reserves the right to make changes or adjustments to this publication at any time without notices or obligations

> 1895 Tobacco Road Augusta, GA 30906

(800) 522-0945

717 North Belair Rd. Evans, GA 30809

(888) 811-0945